

**PUNJAB WATER SUPPLY & SEWERAGE BOARD,  
PLOT NO. 1- B, SECTOR 27-A, CHANDIGARH.**

From

Engineer in Chief cum  
Technical Advisor

To

Chief Engineer (West),  
Punjab Water Supply & Sewerage Board,  
Amritsar.

No. PWSSB-2018/Q.C./ 4459      Dated: 14/3/18

**Subject:-** Inspection by Deputy Team Leader (AMRUT) at Pathankot on dated 06-03-2018 and 07-03-2018 (Broing and installing of 8 Nos tubewells of size 300mm I/d from NGL to 150 mtr depth or where sufficient quantity of potable water is available with percusson rig including temporary water).

During the visit of Sh. J.S. Bhathal, Deputy Team Leader (AMRUT) at Pathankot on dated 06-03-2018 and 07-03-2018 the following points have come to our notice:-

- (i) In the Income tax colony tubewell the work of tile terracing was just started and it was noticed that the work was being done without 25 mm mud plaster under the tile and over the RCC slab. No bitchuman coating was applied to the slab whereas two coats of bitchuman are required as per item no. 13.13. The tiles were being laid on 2 inch thick sand placed over 2 inch thick mud filling.
- (ii) The gravel pit has been constructed as square in place of circular as per standard drawing.
- (iii) At MC colony SAILED 175 mm old garder has been fixed in place of TATA ISMB 200 mm.
- (iv) The 110 mm PVC rain water pipes provided at Bhadroya and others was found to be Non ISI Ravindra 4 Kg/cm<sup>2</sup> and it is required to be imbeded in massonary as per approved drawing. At only one T/well it was embedded in brick work.
- (v) No satisfactory position about the release of electric connections was explained.

You are requested to get the work completed regarding the pending works of electric controle pannals, rising main, fibre glass dome cover, DI fittings, Pressure gauges, V notch haudies Earthing and electric wiring and remove the discrepancies (i) to (v) above. Immediately so that the tubewells are commissioned without further delay.

You may personally check the rectification of above discrepancies. Specification of tile terracing of P.C. completed till date be checked specially whether proper bitumen layer laid. Earth compacted mud plaster etc are OK. Ensure that work be done strictly as per approved drawing and PWD Specification.

You are again requested report within 7 days after attending to the observations pointed above.

*[Signature]*  
Executive Engineer (Q.C)  
For Engineer in Chief cum  
Technical Advisor